

## COMPANY STATEMENT

(Reference JVM410 Heater fuse removal)

### Units affected

Products produced before or during manufacturing week 24 of 2007 (serial number on product states the week of manufacture number ex.: M-2007-24-1234-1).


Affected PCB 's will be marked as PCBP-00129-01 / 02 / 03 / 04

### NOTE:

PCB 's marked as PCBP-00129-05 will already be modified by Marshall Amplification plc and so require no action.

### Action to take

1. Remove fuses and fuse holders from location FS3 & FS4 on PCB and replace with 2 wire links per fuse soldered in positions shown below using WIRE-20045. 21swg Tinned link preformed to 26.5mm long and 5mm high.

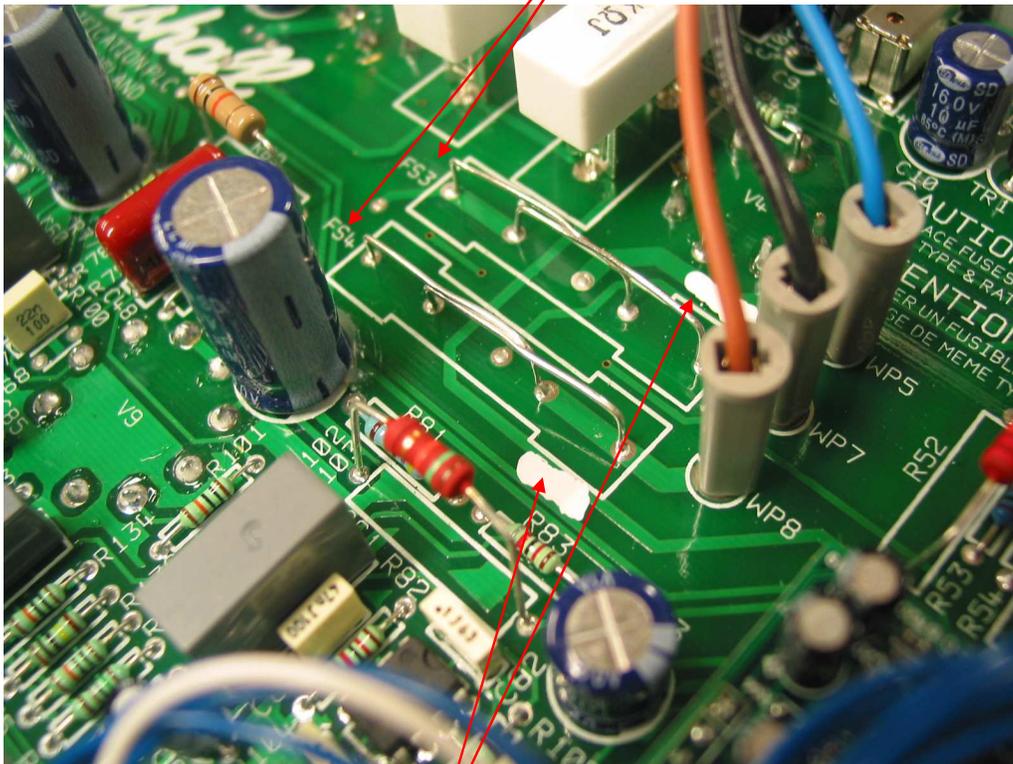

2. Cover fuse ratings of FS3 & FS4 (T10A) marked on PCB silk screen with TIPP-EX.

Path F:\00-bin\016-Company product statements
Issue 1.
Date 08/08.2007
Page 1 of 1